


reaPoint professional

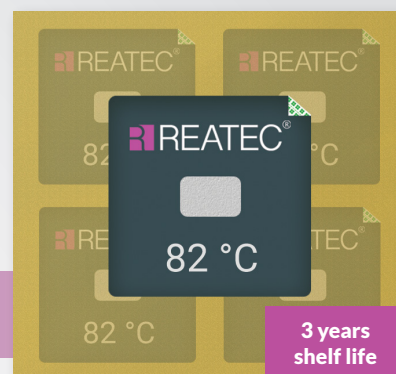

product example: 082.PPP.01.XXX

- self-adhesive temperature measuring points
- robust PET protective film
- for use in environments with harmful substances e.g., water, oils, greases and solvents
- wide range of temperatures - also customizable
- permanent color change from gray to black when the specified indicator temperatures are exceeded
- process monitoring and cost-effective long-term monitoring on surfaces of any kind
- other temperatures on request

product number	temp. °C
037.PPP.01.XXX ¹	37,8
040.PPP.01.XXX ¹	40,6
043.PPP.01.XXX ¹	43,3
046.PPP.01.XXX	46
049.PPP.01.XXX	49
054.PPP.01.XXX	54,4
058.PPP.01.XXX	58
060.PPP.01.XXX	60
062.PPP.01.XXX	62
064.PPP.01.XXX	64
065.PPP.01.XXX	65,6
068.PPP.01.XXX	68
071.PPP.01.XXX	71
075.PPP.01.XXX	75

product number	temp. °C
077.PPP.01.XXX	77
079.PPP.01.XXX	79
080.PPP.01.XXX	80
082.PPP.01.XXX	82
088.PPP.01.XXX	88
090.PPP.01.XXX	90
093.PPP.01.XXX	93
096.PPP.01.XXX	96
099.PPP.01.XXX	99
102.PPP.01.XXX	102
104.PPP.01.XXX	104
108.PPP.01.XXX	108
110.PPP.01.XXX	110
114.PPP.01.XXX	114

product number	temp. °C
116.PPP.01.XXX	116
121.PPP.01.XXX	121
127.PPP.01.XXX	127
132.PPP.01.XXX	132
138.PPP.01.XXX	138
143.PPP.01.XXX	143
149.PPP.01.XXX	149
154.PPP.01.XXX	154
160.PPP.01.XXX	160
166.PPP.01.XXX	166
171.PPP.01.XXX	171
177.PPP.01.XXX	177
182.PPP.01.XXX	182
188.PPP.01.XXX	188

material
plastic
measuring points
1
protected
yes
dishwasher suitable
yes
accuracy
1% above 100 °C +/- 1 °C below 100 °C
reaction time
1-2 sec.
dimensions
17 x 17 mm 13 x 13 mm on request
storage conditions
cool, dry

¹ temperatures 37,8 °C - 43 °C store in a refrigerator

price list / discount			
package	points	price / indicator	price / pack
A	100	on request	on request
B	1000	on request	on request
	from 1001		on request

custom design on request

reaPoint professional

Our REATEC reaPoint professional temperature indicators are based on a self-adhesive plastic carrier, that is protected by a high-quality PET film. The temperature measuring point is placed between these two layers and is protected.

This indicator is characterized by its water and oil repellency, strength, high-density, high performance adhesive and the perfectly adapted material selection gives the fastest possible response time.



product example: booklets with 10 points of 082.ppp.01.XXX

Temperature measuring points in use:

Our temperature measuring points are supplied on sheets of 10 indicators. They are very easy to apply to the object to be measured and have very high adhesion even under strong external loads.

As soon as the specified temperature is exceeded, the temperature measuring point will change color within 1 to 2 seconds.

The color change is irreversible. Once the temperature is exceeded, the temperature measuring points do not change back to the original color, even if the temperature drops again. Critical temperature fluctuations will be indicated even after a long period of time, e.g. during storage and transportation.